



5126 West Terrace Drive, Madison, WI 53718-8346 608 / 242 1550 608 / 242 0787 fax

www.graef-usa.com

CONSULTANTS:

PROJECT TITLE:

BREESE STEVENS REPAIRS

MADISON, WI

FOR CITY OF MADISON PARKS

- 01 REPAIR TEAR IN MEMBRANE AT EDGE/CORNER OF DECK.
- 02 INSTALL NEW EXPANSION JOINT MEMBRANE DOWN FACE OF WALL AT EXISTING EXPANSION JOINT OR MOVING CRACK.
- 03 REPAIR TEAR IN MEMBRANE.
- 04 INSTALL NEW EXPANSION JOINT MEMBRANE ALONG EXPANSION JOINT OR MOVING CRACK.

 
### LEGEND



DEBONDED TOPPING TO BE REPAIRED.





AREAS WITH REMOVED TOPPING TO BE REPAIRED.




= DEBONDED TOPPING - NO WORK UNLESS NOTED OTHERWISE.

- SEE PROJECT MANUAL FO REPAIR SCHEDULE AND UNIT QUANTITIES. - REMOVE AND THEN REINSTALL FENCE, SEATING, AND/OR GUARD RAILS, AS REQUIRED TO PERFORM WORK.
- THE REPAIRS SHOWN ON THESE PLANS ARE NOT FULLY INCLUSIVE OF ALL REPAIRS SHOWN IN THE REPAIR SCHEDULE.
- CONTRACTOR TO SURVEY STADIUM CONDITIONS AND VERIFY UNIT QUANTITIES PRIOR TO STARTING WORK, IF REPAIR QUANTITIES DIFFER FROM DOCUMENTS, THE CONTRACTOR SHALL NOTIFY THE ENGINEER IMMEDIATELY, IF QUANTITIES DIFFER.

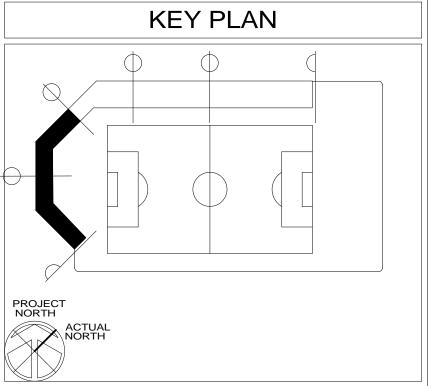

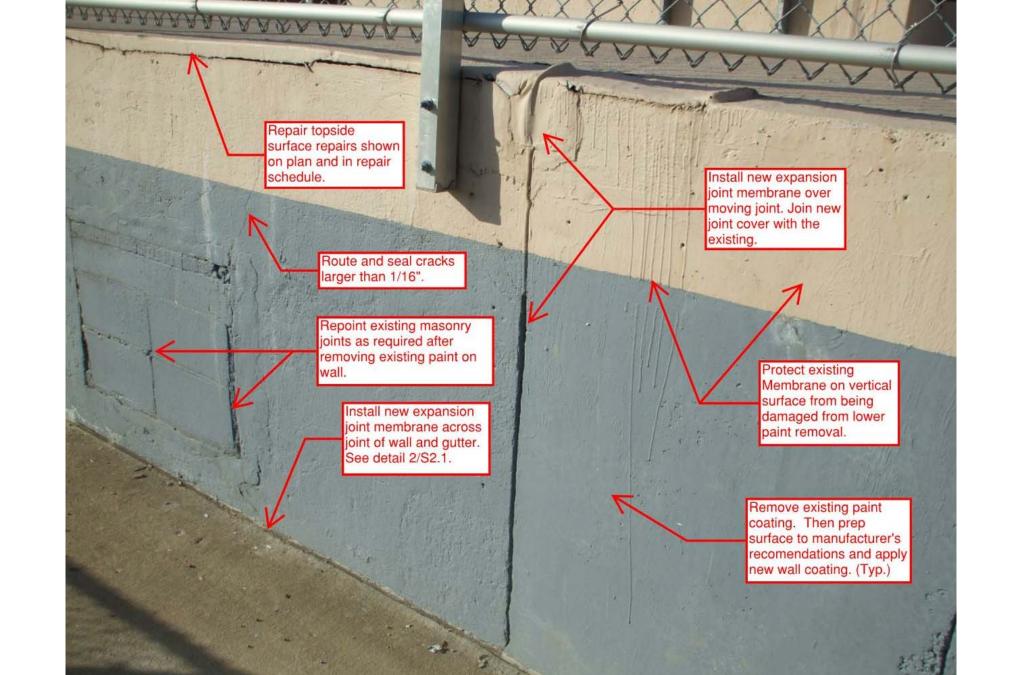



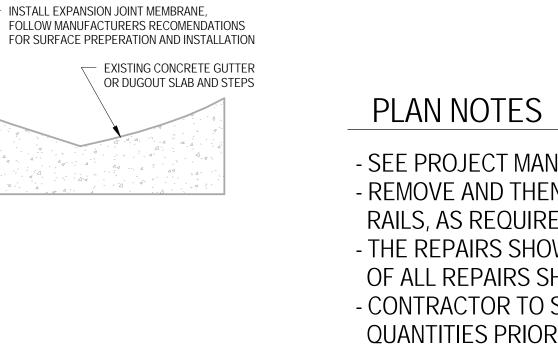

EXISTING CONCRETE FIELD WALL

REMOVE EXISTING PAINT COATING AND INSTALL NEW

WALL BASE JOINT DETAIL

3" = 1'-0"


PROJECT INFORMATION:

PROJECT NUMBER: 2012-5037.00 2/25/2013

CHECKED BY: APPROVED BY: DFW SCALE: AS NOTED

SHEET TITLE: PARTIAL PLAN A1-G4

SHEET NUMBER:

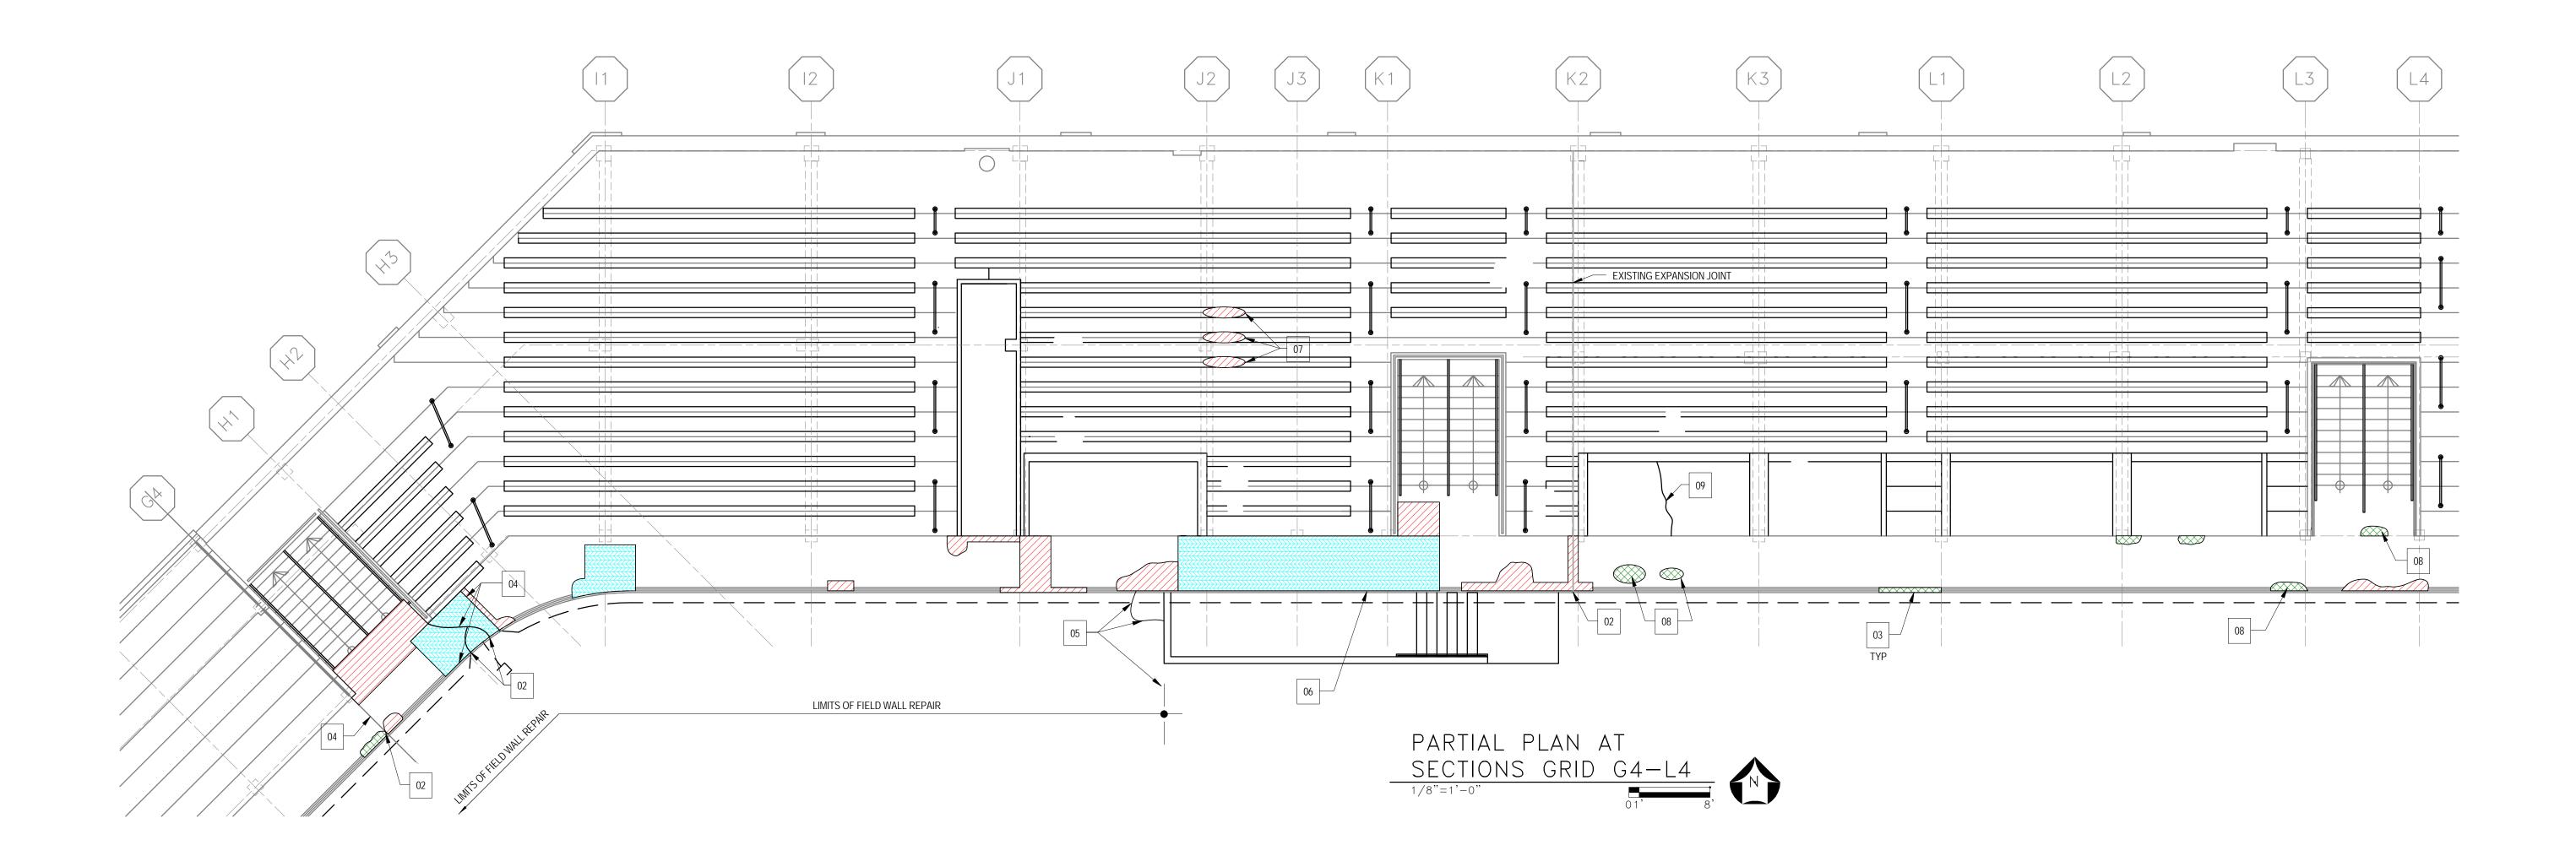



5126 West Terrace Drive, Suite 111 Madison, WI 53718-8346 608 / 242 1550 608 / 242 0787 fax

www.graef-usa.com

CONSULTANTS:


PROJECT TITLE:

BREESE STEVENS REPAIRS

MADISON, WI

FOR CITY OF MADISON PARKS DEPARTMENT

ISSUE:

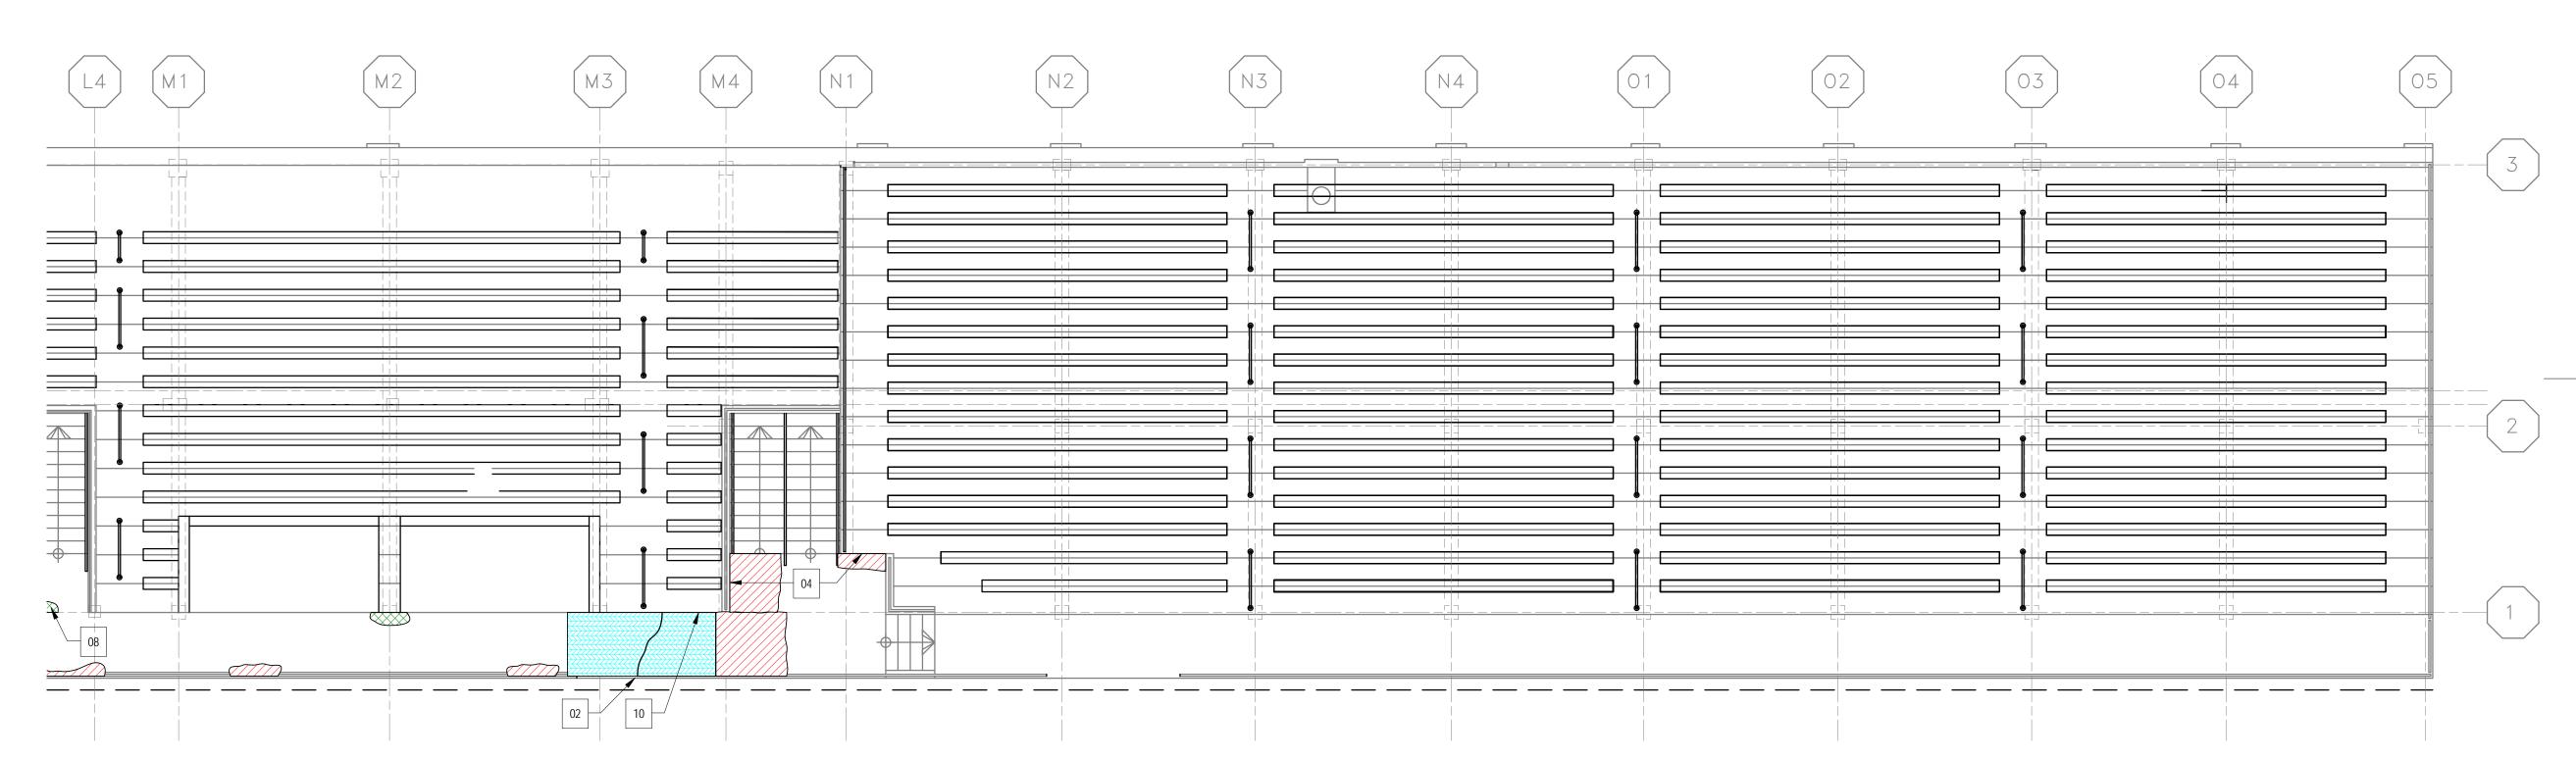

### PLAN KEYNOTES

- 01 REPAIR TEAR IN MEMBRANE AT EDGE/CORNER OF DECK.
- 02 INSTALL NEW EXPANSION JOINT MEMBRANE DOWN FACE OF
- WALL AT EXISTING EXPANSION JOINT OR MOVING CRACK.
- 03 REPAIR TEAR IN MEMBRANE.
- 04 INSTALL NEW EXPANSION JOINT MEMBRANE ALONG EXPANSION
  - JOINT OR MOVING CRACK.
- 05 ROUTE AND SEAL CRACKS IN GUTTER. 06 ROUTE AND SEAL CRACK IN CMU WALL.
- 07 UNDERSIDE PARTIAL DEPTH PATCH REPAIR IN BATHROOM.
- 08 EPOXY INJECT DELAMINATED TOPPING AND REPAIR MEMBRANE AT INJECTION PORTS.
- 09 ROUTE, SEAL, AND REPAIR MEMBRANE.

10 PROVIDE 1/2" ISOLATION MATERIAL WITH SEALANT AND MEMBRANE AT EXISTING CRACK AT FACE OF RISER.

PARTIAL PLAN AT SECTIONS GRID L4-05

## PLAN NOTES

 
- SEE PROJECT MANUAL FO REPAIR SCHEDULE AND UNIT QUANTITIES. - REMOVE AND THEN REINSTALL FENCE, SEATING, AND/OR GUARD RAILS, AS REQUIRED TO PERFORM WORK.

- THE REPAIRS SHOWN ON THESE PLANS ARE NOT FULLY INCLUSIVE OF ALL REPAIRS SHOWN IN THE REPAIR SCHEDULE.

- CONTRACTOR TO SURVEY STADIUM CONDITIONS AND VERIFY UNIT QUANTITIES PRIOR TO STARTING WORK, IF REPAIR QUANTITIES DIFFER FROM DOCUMENTS, THE CONTRACTOR SHALL NOTIFY THE ENGINEER IMMEDIATELY, IF QUANTITIES DIFFER.

# LEGEND


DEBONDED TOPPING TO BE REPAIRED.



AREAS WITH REMOVED TOPPING TO BE REPAIRED.



 DEBONDED TOPPING - NO WORK UNLESS NOTED OTHERWISE.

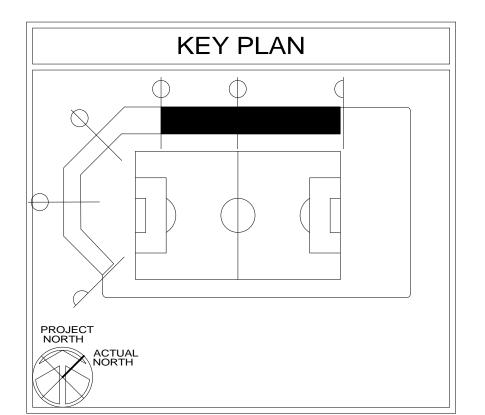

PROJECT INFORMATION: PROJECT NUMBER: 2012-5037.00

DATE: 2/25/2013

CHECKED BY:

APPROVED BY: SCALE: AS NOTED

PARTIAL PLAN G4-05

SHEET NUMBER:

SHEET TITLE: